

No.1 Additional Key Registration Procedure (Using Two Valid Keys)

Conditions


- Have two or more valid keys.

Note

- A maximum of eight keys can be registered for any one vehicle. If key registration is not successful and DTC 15 appears even though the procedure was performed properly, use the PID/data monitor function of the M-MDS and verify the number of keys that have been registered.
- If eight keys have already been registered, and it is necessary to register other keys, the previously registered key ID numbers must first be cleared. To clear the key ID numbers, refer to "09-14-41 No.3 Key Replacement Procedure (Clearing Previously Programmed Key ID Numbers, Key Re-program)".

09-14

Procedure

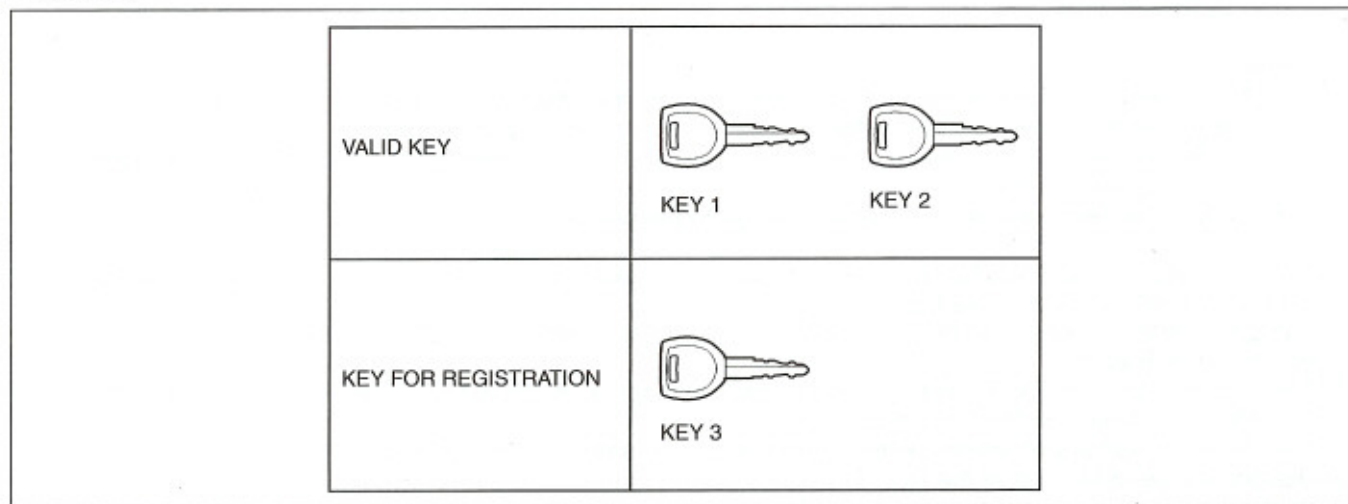

acxuuw00002525

1. Have one key (key 3) ready for registration.
2. Using key 1, turn the ignition switch to the ON position.
3. Verify that the security light illuminates for **approx. 3 s** and then goes out.
4. Using key 1, turn the ignition switch to the LOCK position **within approx. 4 s** after the security light goes out.
5. Remove key 1
6. Repeat Steps 2—5 using key 2.
7. Repeat Steps 2—5 using key 3.
8. If additional keys need to be registered, repeat Steps 2—5 in the same manner as key 4.
9. Verify that the all keys can start the engine for **5 s or more** after the procedure.